
#### **DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES Office of Structural Materials Quality Assurance and Source Inspection

Bay Area Branch 690 Walnut Ave.St. 150 Vallejo, CA 94592-1133 (707) 649-5453 (707) 649-5493

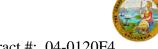

Contract #: <u>04-0120F4</u>

Cty: <u>SF/ALA</u> Rte: <u>80</u> PM: <u>13.2/13.9</u>

File #: 69.15

## SOURCE INSPECTION REPORT

Resident Engineer: Pursell, Gary

Address: 333 Burma Road

Report No: SIR-000648

Date Inspected: 02-Jun-2009

City: Oakland, CA 94607

Project Name:SAS SuperstructureOSM Arrival Time:0Prime Contractor:American Bridge/Fluor Enterprises, a JVOSM Departure Time:12

Contractor: Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island Location: Changxing Dao, Shangha

Quality Control Contact: ABF Paint Supervisor William (BQ) alidy Control Present: Yes No

**Material transfer:** Yes No N/A **Sampled Items:** Yes No N/A **Stock Transfer:** Yes N/A OK to Cut: N/A No Yes No **Rebar Test Witness:** Yes **Delayed/Cancelled:** N/A No N/A Yes No

Other: Surface Preparation and Coatings Application

**Bridge No:** 34-0006 **Component:** OBG 5CE, Tower L1E

**Bid Item:** 77,78,79,80 **Lot No:** B226

### **Summary of Items Observed:**

On this date Caltrans Office of Structural Materials (OSM) Quality Assurance (QA) NACE III coating inspector, Mr. Donald Jordan arrived on site at the Zhenhua Port Machinery Company (ZPMC) facility at Changxing Island in Shanghai, China. The purpose of the coating inspections are to monitor the surface preparation and coating applications for the SAS Bay Bridge project. This QA NACE III coating inspector observed the following: The following inspections were performed by Caltrans QA Coatings Inspector Jordan, American Bridge/Fluor Enterprises, a JV (ABF) Paint Supervisors William (Bill) Oak and Don Walton, ABF QC Zhou Qun Song (Joe), ABF QC David Duon, ABF QC Shi Zhaoyuan (Stone), ABF QC Zhou Wei, International Paint (IP) Onsite Technical Services Engineer (OTSE) Peng Zi Li, IP OTSE Alpha Chen, Zhenhua Port Machinery Company, LTD (ZPMC) QC Manager Xia Yong, ZPMC QC Zhang Diang, ZPMC QC Dong Yao Fei and ZPMC QC Guo Wan Li.

### **OBG 5CE**

Caltrans QA Coatings Inspectors received a Notice of Inspection for to attend a joint inspection with ABF and ZPMC QC to locate visual surface anomalies and weld defects on the floor area of OBG 5CE. ABF verbally requested that the Caltrans welding staff be notified to perform VT inspection after blast. Areas requiring grinding were identified and marked by QC and QA staff. Caltrans QA Weld Inspector's performed VT inspection to locate and mark any weld repairs required. The weld repair spots were identified by placing tape over the area so it can be located after primer application. After the inspection was complete, grinding was performed to remove base metal defects. Abrasive blasting resumed after grinding was completed. NO ZPMC or ABF steel inspectors were on site looking at the welds.

Tower Lift 1 East

# SOURCE INSPECTION REPORT

(Continued Page 2 of 2)

ABF Tower Paint Supervisor Don Walton issued an NCR on Tower Lift 1 East. The touchup on the interior of the tower was not complete prior to moving out of the blast shop. Caltrans Structural Materials Representative (SMR) Andrew Ferng was informed of the situation.

Fabrication on assembled components of the OBG's and Towers are not complete. Outstanding weld repairs have not been performed. Coating damage requiring re-blast is expected.





### **Summary of Conversations:**

There were no relevant conversations on this date.

#### **Comments**

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh (China) +8613472477571, who represents the Office of Structural Materials for your project.

Inspected By:	Jordan,Don	Quality Assurance Inspector
Reviewed By:	Carreon, Albert	QA Reviewer